



ISTORIC
#Reprezentanță



Vehicle

BMW 320D A, 135KW

WBA3D31020J552768



Development code

F30

Colour

black-sapphire metallic

Actual integration level

F020-13-03-503

Start of warranty

29 April 2013



Information on faults workshop/Service Consultation

Navigation map

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map Europe MOVE 2013 (As of: 22-Jul-2020)	No valid subscription available.	-	Road Map Europe West MOVE 2021 Road Map Europe East MOVE 2021

Vehicle details

Vehicle type	Passenger car
Brand	BMW
Model	320D A
Body	LIM
Vehicle identification number (last 7 digits)	J552768
Vehicle identification number (17 digits)	WBA3D31020J552768
Development code	F30
Steering	LL
Engine	N47T
Engine number	86418501
Exhaust re-treatment	EURO5, J, PI/CI, M, N1 I

Transmission	AUT
Transmission number	0398966X8G
Head unit serial number	0000446740
Drive	HECK
Integration level, works	F020-13-03-503
Production date	18-Apr-2013
Production plant	Regensburg
Delivery date	23-Apr-2013
Delivering retailer	Niederlassung Frankfurt, Frankfurt am Main, DE
National-market version	EUR
Paint code	475
Upholstery code	BEL2
Model code	3D41
Basic type	3D31
Lead type	3D41

Optional equipment

Optional equipment ex works:

01CA Selection of COP-relevant vehicles
0216 Hydro steering-servotronic









Retrofitted optional equipment:


This vehicle has no retrofits.

0230 Extra package, EU-specific
0249 Multifunction steering wheel
0258 Tyres with runflat properties
02A5 BMW LA wheel, double spoke 397
02TB Sport automatic gearbox
0320 Deleted, model lettering
03DZ Omission of additional lettering, outer
0420 Sun protection glazing
0423 Floor mats velours
0428 Warning triangle and first aid kit
0465 Through-loading system
0481 Sports seat
0494 Seat heating driver/passenger
04AT Interior trim finishers black high-gloss
04DN Accent strips, korall-rot matt
0502 Headlight cleaning system
0508 Park Distance Control (PDC)
0520 Fog lights
0521 Rain sensor
0522 Xenon Light
0534 Automatic air conditioning
0544 Cruise control with brake function
0548 Kilometre speedo
0575 Additional 12V sockets
0606 Navigation system Business
0676 HiFi speaker system
0698 Area-Code 2 for DVD
06AC Intelligent emergency call
06AE Teleservices
06NS Comfort telephony w/ enhanced Smartphone
0704 M Sports suspension
0710 M leather steering wheel
0775 Headlining anthracite
07AC Sport Line
0801 National version Germany

0851 Language version German
 0879 On-board literature, German
 08KA Oil service interval 24 mths / 30,000 km
 08V1 Information plate
 09BD Business Package
 A090 90 Ah AGM battery

Vehicle histories

	Date	Type	Vehicle mileage	Retailer	Overview
—	17/12/2021	Repair	216054 Km	33406	Job
—	Job				
	Description: INLOCUIT GARNITURI TERMOFLOT / INLOCUIT CLAPETE ADMISIE Considered as a repeat visit No Customer's own words				
—	22/07/2020	Key	181186 Km	00085	Key 1
	<div> <div>  <div>16000</div> <div>11/2021</div> </div> <div>  <div>16000</div> <div>496</div> </div> <div>  <div>16000</div> <div>496</div> </div> <div>  <div>16000</div> <div>496</div> </div> <div>  <div>34000</div> <div>07/2020</div> </div> <div>  <div>0</div> <div>07/2020</div> </div> <div>  <div>50000</div> <div></div> </div> <div>  <div>16000</div> <div>11/2021</div> </div> <div>  <div>0</div> <div>06/2022</div> </div> <div>  <div>0</div> <div>06/2022</div> </div> </div>				
—	25/06/2020	Key	178595 Km	00085	Key 1

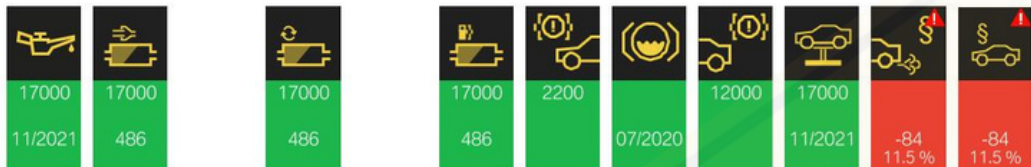

— 25/06/2020 Repair 178595 Km 00085 Job
Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words Check cooling system for watertightness with special tool externally, no visible loss then temp sensor removed and seen with an endoscope, the exit side looks wet then in the developed...

Check the cooling system for watertightness with the special tool 4 FRU
Flat rate unit I 17 00 009

Removing and installing or replacing EGR cooler 14 FRU
Flat rate unit I 11 71 600

Anti-freeze 4
Part I 83 19 2 211 358

exhaust cooler 1
Part I 11 71 7 810 751

Gasket Steel 1
Part I 11 61 8 571 005

— Job

Description:

Considered as a repeat visit No

Customer's own words

Reworking steering box	12 FRU
Flat rate unit I 00 66 853	

Cavity protection spray	0
Part I 83 42 2 457 337	

ScotchBrite Multiflex	0
Part I 51 91 0 402 967	

Repair kit screws	1
Part I 32 10 6 891 831	

— Job

Description:

Considered as a repeat visit No

Customer's own words

kostenlose Fahrzeugoberwäsche	Local	1
Part I 0011319		











— Job

Description:

Considered as a repeat visit No

Customer's own words

—	09/07/2018	Key	141672 Km	22527	Key 1
---	------------	-----	-----------	-------	-------

									
11000	11000	11000	11000	33000	0	60000	11000	0	0
07/2019	387	387	387		-100 13.7 %		07/2019	-100 13.7 %	-100 13.7 %

— 26/02/2018 Key 136782 Km 22527 Key 1

									
18000	18000	18000	18000	2200	0	14000	18000	0	0
07/2019	520	520	520		03/2018		07/2019	03/2018	03/2018

— 19/02/2018 Repair 136072 Km 22527 Job
Job
Job

— Job

Description:

Considered as a repeat visit No

Customer's own words

Job time without allowance for / body equipment 2 FRU
Flat rate unit I 51 99 000

Stripping and refitting work for painting side panel, rear right 5 FRU
Flat rate unit I 51 18 725

Removing and installing rear left or right door 3 FRU
Flat rate unit I 41 52 580

Adjusting rear left or right door. 2 FRU
Flat rate unit I 41 52 504

Removing and installing or replacing water strip on left or right side of windshield Flat rate unit I 51 31 530	1 FRU
Remove and install/replace left or right side sill trim panel Flat rate unit I 51 71 947	4 FRU
Removing and installing or replacing reflector Flat rate unit I 63 14 621	1 FRU
Removing and installing or replacing reflector Flat rate unit I 63 14 621	1 FRU
Replacing rear left or right door Flat rate unit I 41 52 501	40 FRU
Removing and installing rear bumper panel Flat rate unit I 51 12 656	5 FRU
Removing and installing/replacing one ultrasonic sensor at the rear Flat rate unit I 66 20 542	1 FRU
Removing and installing/replacing rear left or right bumper guide Flat rate unit I 51 12 828	2 FRU
Job time without allowance for / body equipment Flat rate unit I 51 99 000	2 FRU
Removing and installing/replacing one ultrasonic sensor at the rear Flat rate unit I 66 20 542	1 FRU
Removing and installing left or right roof trim strip Flat rate unit I 51 13 780	1 FRU
Performing vehicle test Flat rate unit I 00 00 556	2 FRU
Replacing cover pot Flat rate unit I 41 63 503	4 FRU

Removing and installing or replacing left or right rain channel trim strip Flat rate unit I 51 13 816	2 FRU
!!! unknown BMW-Id 41H0010 FZG Verbringung !!! Flat rate unit I 41H00 10	7 FRU
Repair kit, window glass, cold, 1 hour Part I 83 19 2 289 285	1
Cleaner R1 Part I 83 19 2 211 217	1
Fillister head screw Part I 07 14 7 127 714	12
Expanding nut Part I 63 12 1 374 075	2
Clip with washer, natur Part I 51 41 8 224 768	8
Clamp Part I 51 41 8 240 509	6
Rear reflector, rear left Part I 63 14 7 382 233	1
Side window, fixed, rear right Part I 51 35 7 269 558	1
Set, template, door, rear Part I 01 29 2 317 853	1
Drip moulding, right Part I 51 31 7 258 188	1
Guide for bumper, side, right Part I 51 12 7 384 466	1

Holder, load area net, front right
Part I 51 47 7 331 422

1

Rear reflector, rear right
Part I 63 14 7 301 188

1

Sound insulating door rear right
Part I 51 48 7 286 652

1

Door weatherstrip, rear
Part I 51 35 7 258 330

1

Clip, moulding, side frame
Part I 51 13 7 117 240

10

Trim, load area net, rear right
Part I 51 47 7 376 950

1

Door, rear right
Part I 41 00 7 298 514

1

— Job

Description:

Considered as a repeat visit No

Customer's own words

— Job

Description: Unsere kostenlose Service-Leistung für Sie

Considered as a repeat visit No

Customer's own words

Service consultation at vehicle with Service Ticket
Flat rate unit I 00 52 052

0 FRU

Betriebsmittelüberprüfung mit Fahrzeugzustandskontrolle
Flat rate unit I 77H00 03

1 FRU

Kostenlose Wagen-Oberwäsche
Flat rate unit I 00 11 319

1 FRU

— 05/02/2018 Key 136068 Km 00430 Key 1

 18000 07/2019	 18000 540	 18000 540	 18000 540	 2200 03/2018	 0 03/2018	 15000 07/2019	 18000 03/2018	 0 03/2018	 0 03/2018
---	---	---	---	--	---	---	--	---	---











— 20/01/2016 Key 95583 Km 02756 Key 1

 15000 04/2017	 15000 466	 15000 466	 15000 466	 21000 04/2016	 0 04/2016	 3200 04/2017	 15000 04/2016	 0 04/2016	 0 04/2016
---	---	---	---	---	---	--	--	---	---

— 28/08/2015 Key 91227 Km 37771 Key 0

 19000 04/2017	 19000 610	 19000 610	 19000 610	 23000 04/2016	 0 04/2016	 7000 04/2017	 19000 04/2016	 0 04/2016	 0 04/2016
---	---	---	---	---	---	--	--	---	---

— 10/04/2015 Key 82837 Km 31227 Key 0



— 10/04/2015 Repair

82837 Km

31227

Job

Job

— Job

Description: Wartung durchführen

Considered as a repeat visit No

Customer's own words

Service consultation at vehicle with Service Ticket

Flat rate unit I 00 52 052

0 FRU

Service - standard scope

Flat rate unit I 00 00 105

2 FRU

Vehicle surface wash

Flat rate unit I 00 11 319

3 FRU

Engine oil service

Flat rate unit I 00 00 610

3 FRU

Microfilter service

Flat rate unit I 00 00 616

2 FRU

Service, front brakes

Flat rate unit I 00 00 612

6 FRU

Set oil-filter element

Part I 11 42 8 507 683

1

Microfilter/activated Carbon container
Part I 64 11 9 237 555

1

Motor oil SAE 5W-30 Longlife-04
Part I 83 21 0 398 509

5.2

Repair kit, brake pads asbestos-free
Part I 34 10 6 859 181

1

Windshield washer antifreeze
Part I 83 12 2 298 206

1

Hex Bolt
Part I 34 11 6 772 117

4

Brake pad wear sensor, front left
Part I 34 35 6 792 289

1

Brake cleaner
Part I 83 19 2 153 367

2

Brake-pad paste
Part I 83 19 2 158 851

2

— Job

Description: Sommerräder montieren C10-583

Considered as a repeat visit No

Customer's own words


Remove and install wheel with power tool (Dummy)
Flat rate unit I 36 99 001

2 FRU

!!! unknown BMW-Id 3699003 Einlagerungsgebühr Saison !!!
Flat rate unit I 36 99 003

4 FRU

— 28/01/2015 Key 71430 Km 31227 Key 0

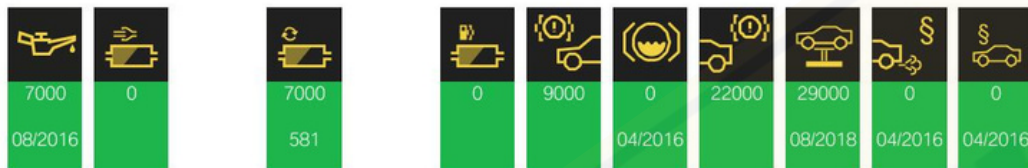

— 28/01/2015 Repair 71430 Km 31227 Job

— Job

Description: Winterräder montieren C10-583

Considered as a repeat visit No

Customer's own words

Replacing a tyre with run-flat technology 6 FRU
Flat rate unit I 36 12 506

Fetch and bring service zone 4 FRU
Flat rate unit I 00 99 200

!!! unknown BMW-Id 3699003 Einlagerungsgebühr Saison !!! 4 FRU
Flat rate unit I 36 99 003

!!! unknown BMW-Id 3699002 Winterräder montiert !!! 4 FRU
Flat rate unit I 36 99 002

Bridgestone Blizzak LM-32 RFT 1
Part I 85 45 2 549 142

VENTILE/GEWICHTE Freigabe: 01/53768/5 Local 1
Part I FT99 99 0 000 1

— 12/08/2014 Repair 55123 Km 31227 Job

— Job

Description: Wartung

Considered as a repeat visit No

Customer's own words

Vehicle surface wash	3 FRU
Flat rate unit I 00 11 319	

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Service consultation at vehicle with Service Ticket	0 FRU
Flat rate unit I 00 52 052	

Removing and installing or replacing both front brake discs	3 FRU
Flat rate unit I 34 11 613	

Service, rear brakes	7 FRU
Flat rate unit I 00 00 614	

Removing and installing or replacing both rear brake discs	4 FRU
Flat rate unit I 34 21 932	

Replacing both wiper blades	1 FRU
Flat rate unit I 61 61 541	

Service - air filter element	2 FRU
Flat rate unit I 00 00 602	

Service fuel filter	3 FRU
---------------------	-------

Flat rate unit I 00 00 604

Service, vehicle check 6 FRU

Flat rate unit I 00 00 624

Service, front brakes 6 FRU

Flat rate unit I 00 00 612

Motor oil SAE 5W-30 Longlife-04 5.2

Part I 83 21 0 398 509

Window cleaner, concentrate 2

Part I 83 12 2 298 203

Microfilter/activated Carbon container 1

Part I 64 11 9 237 555

Brake cleaner 1

Part I 83 19 2 154 780

Set oil-filter element 1

Part I 11 42 8 507 683

Brake pad wear sensor, front left 1

Part I 34 35 6 792 289

Brake disc, ventilated 2

Part I 34 11 6 792 219

Brake disc, ventilated 1

Part I 34 11 6 792 219

Inner hex bolt 2

Part I 34 21 1 161 806

Brake-pad paste 4

Part I 83 19 2 158 851

Air filter element 1

Part I 13 71 8 507 320

Fuel filter cartridge

1

Part I 13 32 8 572 522

Repair kit, brake pads asbestos-free

1

Part I 34 10 6 859 181

Brake disc, ventilated

2

Part I 34 21 6 792 227

Brake disc, ventilated

1

Part I 34 21 6 792 227

Hex screw with collar

2

Part I 34 20 6 850 536

Set of wiper blades

1

Part I 61 61 2 241 375

Hex Bolt

4

Part I 34 11 6 772 117

Repair kit, brake pads asbestos-free

1

Part I 34 21 6 850 569

Brake-pad sensor, rear

1

Part I 34 35 6 792 292

Inner hex bolt

2

Part I 34 21 1 161 806

—

02/06/2014 Key

46375 Km

31227

Key 0

									
3200	3200	3200	3200	10000	0	2200	3200	0	0
11/2015	546	546	546		04/2016		11/2015	04/2016	04/2016

— 02/06/2014 Repair 46375 Km 31227 Job
Job

— Job

Description: Sommerräder montieren C10/583

Considered as a repeat visit No

Customer's own words

Service consultation at vehicle with Service Ticket 0 FRU
Flat rate unit I 00 52 052

Remove and install wheel with power tool (Dummy) 4 FRU
Flat rate unit I 36 99 001

Vehicle surface wash 3 FRU
Flat rate unit I 00 11 319

!!! unknown BMW-Id 3699003 Einlagerungsgebühr Saison !!! 4 FRU
Flat rate unit I 36 99 003

— Job


Description: Wasserablaufftülle Aggregateräume ausbauen

Considered as a repeat visit No

Customer's own words

Remove water drain grommet of units compartment 4 FRU
Flat rate unit I 00 61 960

— 26/11/2013 Key 24072 Km 31227 Key 0

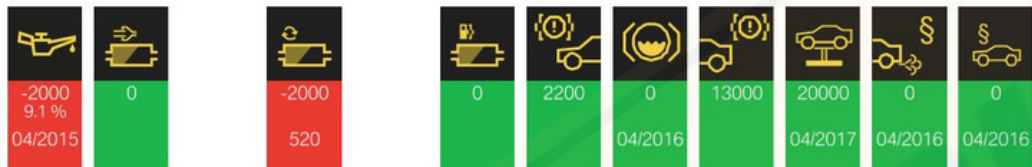

— 26/11/2013 Repair 24072 Km 31227 Job
Job

— Job

Description: Wartung durchführen

Considered as a repeat visit No

Customer's own words

Service - standard scope	2 FRU
Flat rate unit I 00 00 105	

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Microfilter service	2 FRU
Flat rate unit I 00 00 616	

Windshield washer antifreeze	1
Part I 83 12 2 298 206	

Set oil-filter element	1
Part I 11 42 8 507 683	

Motor oil SAE 5W-30 Longlife-04	5.2
Part I 83 21 0 398 509	

— Job

Description: Winterräder montieren

Considered as a repeat visit No

Customer's own words

Service consultation at vehicle with Service Ticket 0 FRU
Flat rate unit I 00 52 052


!!! unknown BMW-Id 3699002 Winterräder montiert !!! 4 FRU
Flat rate unit I 36 99 002

!!! unknown BMW-Id 3699003 Einlagerungsgebühr Saison !!! 4 FRU
Flat rate unit I 36 99 003


— 03/05/2013 Key 6 Km 31227 Key 0



Ulei motor +
filtru

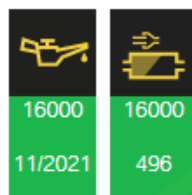


Filtru habitacul
(polen)




Filtru
combustibil




Lichid de
frana



Verificare
vehicul



Inspectie
generală



Filtru aer
motor

Placute frana
punte fata

Placute frana
punte spate

Verificare emisii
in stationare